


# MOVE PROTECTS BRACKET

WITH THAT  
NEW APU,  
YOU SHOULD  
BE GOOD  
TO GO!



YEAH, IF ONLY YOU  
HADN'T BROKEN MY  
OVERHEAD FAN  
RELAY ASSEMBLY  
BRACKET...

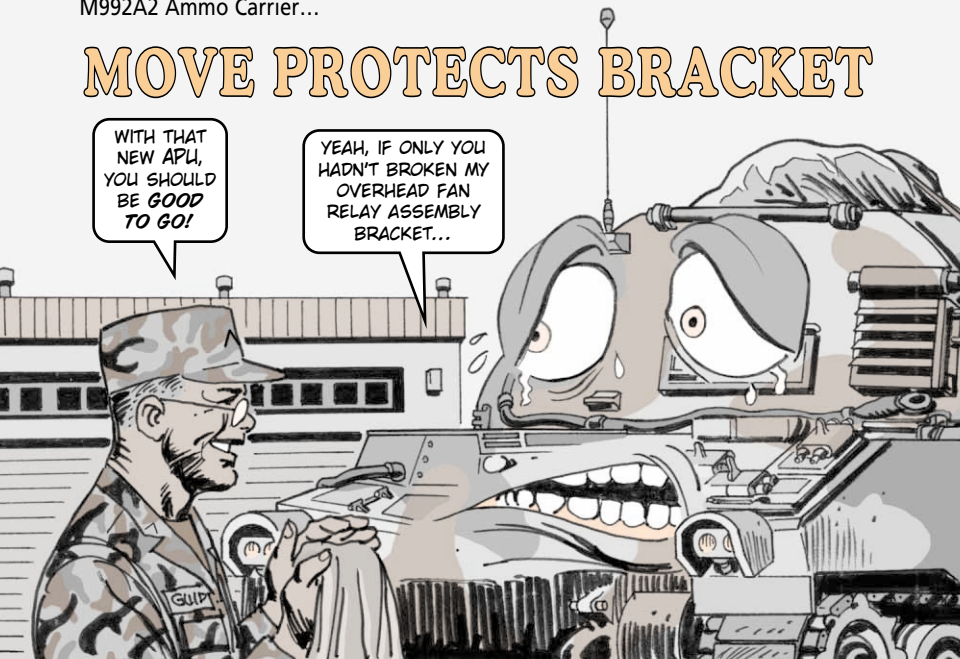

**D**oes your ammo carrier have a Hatz 2G40 auxiliary power unit (APU)? If so, the overhead fan relay assembly bracket is in danger.

In its current position, the bracket is easily damaged when the APU is removed or installed. Since the bracket isn't available in the supply system, you have to replace the entire fan relay assembly, NSN 5945-01-456-6726.

Protect the bracket by having your mechanic relocate the fan relay assembly to the backside of the APU intake shroud. The bracket attaches easily using one of the existing shroud mounting bolts.

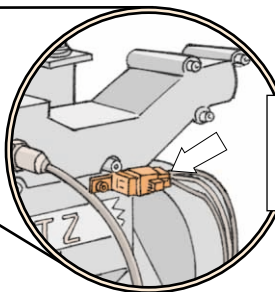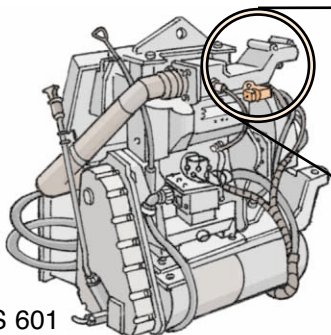

Relocate  
fan relay  
assembly  
here